#### WORK INSTRUCTION

Title: Repair of Inner Containment Vessel (ICV)/Outer Containment Vessel (OCV) Locking Ring Stop Plate(s)

Instruction No. CH.16

Rev. 0.1, November 2002

Page 1 of 3

Approved for Use by: Michael R. Brown

Effective Date: November 2002

# Applicable Drawings:

- 2077-500SNP (Sheet 8) TRUPACT-II Packaging Safety Analysis Report for Packaging (SARP) Drawings
- 707-SAR (Sheet 10) HalfPACT Packaging SARP Drawings

# SARP Requirements:

None

# Tools Required:

- Small grinder
- Welder (TIG preferred)

#### Spare Parts Required:

None

### Materials Required:

- 304 stainless steel, 12 gauge (w/Certified Material Test Report)
- Weld filler material per approved weld procedure (w/cmtr)

#### Safety Requirements:

Safety will be observed in accordance with site requirements.

#### Prerequisite Conditions:

- ICV/OCA lid(s) must be removed.
- Welder must be qualified in accordance with Section IX of American Society of Mechanical Engineers (ASME) Code for the process being used.
- Weld procedures and inspection procedures must have been approved by the Management and Operating Contractor.
- Preferred weld method is gas tungsten arc welding for A-240 stainless steel.

# **Instruction Steps:**

- All steps in this procedure must be documented on the Data Sheet (Attachment 1) or on an attached approved manufacturing traveler to the data sheet.
- This instruction is not required to be attached to the Maintenance Record, but may be used as a checklist during performance of maintenance.
- Attachment 1 shall be completed for each locking ring stop repaired/replaced.

Instruction No. CH.16

Rev. 0.1, November 2002

Page 2 of 3

CAUTION: Be careful not to grind into the base metal of the vessel.

- 1.0 Indicate on Attachment 1 which component stop or stops are being replaced.
- 2.0 Remove the old stop(s) by grinding.
- 3.0 Cut a piece(s) of 12 gauge 304 stainless steel from a certified sheet of stock.
- 4.0 Record the Certified Material Test Report (CMTR) number and Purchase Order Number of the original stock sheet.
- 5.0 Record the weld procedure number, revision, and date.
- 6.0 Grind the piece(s) of stainless steel to the required dimensions of the drawing. Bevel as required to aid in welding and fit-up.
- 7.0 Record the weld filler CMTR Number.

NOTE: The OCV lock ring stop on Unit 129 is the fifth lug clockwise from the OCV seal test port.

- 8.0 Tack the piece(s) of stainless steel in place per the current revision of drawing #2077-500SNP, Sheet 8 of 11, Section AY-AY, or Section AX-AX, or #707-SAR, Sheet 10 of 12, Section AZ-AZ, or Section BB-BB.
- 9.0 Verify the location and fit-up of the locking ring stop per drawing #2077-500SNP, Sheet 8 of 11, Section AY-AY or AX-AX, or #707-SAR, Sheet 10 of 12, Section AZ-AZ, or Section BB-BB.
- 10.0 Complete the weld(s) on the locking ring stop per drawing #2077-500SNP, Sheet 8 of 11, Section AY-AY or AX-AX, or #707-SAR, Sheet 10 of 12, Section AZ-AZ, or Section BB-BB.
- 11.0 Perform a visual inspection of the weld(s) in accordance with American Welding Society (AWS) Procedure D1.1.
- 12.0 Perform a liquid penetrant inspection of the weld(s) to ASME Code, Section III, Division 1, Subsection NB, Article NB-5000, and Section 5, Article 6.
- 13.0 Attach a copy of the inspection report(s) and CMTR(s) to the traveler or data sheet.
- 14.0 Verify the stop(s) was properly installed by: (1) installing the lid, (2) rotating the lid to the full open and full closed positions, and (3) removing the lid.
  - The lid should not bind on the new stop during lifting or lowering.
  - The lid open and closed marks should line up when the locking ring is against the locking ring stop.

# Verification Requirements:

- 1.0 Work performed is described on Maintenance Record.
- 2.0 Work instruction is listed on Maintenance Record.
- 3.0 Data sheet (Work Instruction CH.16, Attachment 1) or traveler is attached to Maintenance Record.

Instruction No. CH.16

Rev. 0.1, November 2002

Page 3 of 3

# ATTACHMENT 1 - DATA SHEET

Packaging SERIAL #:Date:		Job. No.:
STEP	OPERATION	SIGNOFF Operator / Date
1.	Check appropriate block  ☐ ICV Locking Ring Stop  ☐ OCV Locking Ring Stop	
2.	Remove old stop	
3.	Cut new stop	
4.	Record : CMTR #_ PO #_	
5.	Record weld procedure number, rev, and date	
6.	Grind new stop	
7.	Record filler CMTR #	
8.	Tack stop in place	
9.	Verify stop location and fit	QC
10.	Complete weld per dwg. 2077-500SNP, Sheet 8 of 11, Section AY-AY and/or Section AX-AX, or Dwg. #707-SAR, Sheet 10 of 12, Section AZ-AZ, or Section BB-BB.	
11.	Perform visual inspection	QC
12.	Perform liquid penetrant inspection	QC
13.	Attach inspection report(s), CMTR(s)	QC
14.	Perform retest	